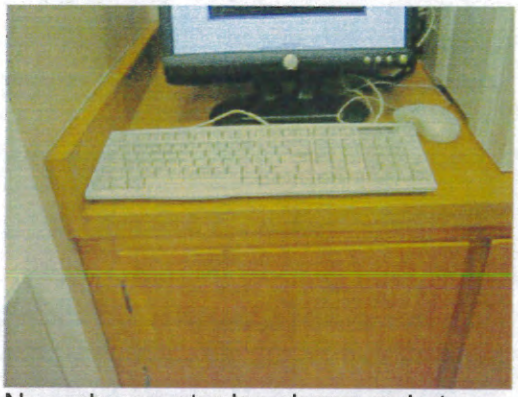

No under counter leg clearance but parallel approach compliant

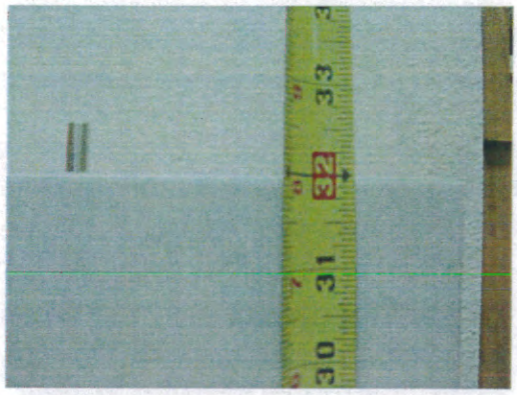

Pay station compliant for reach heights

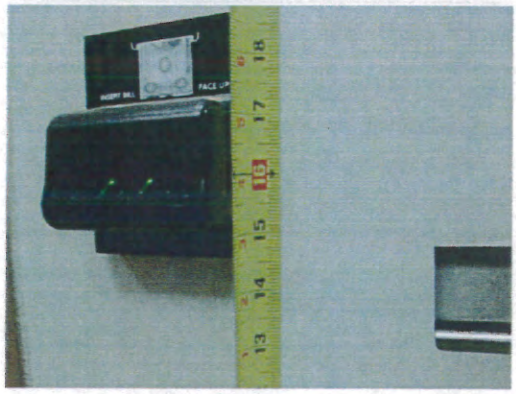

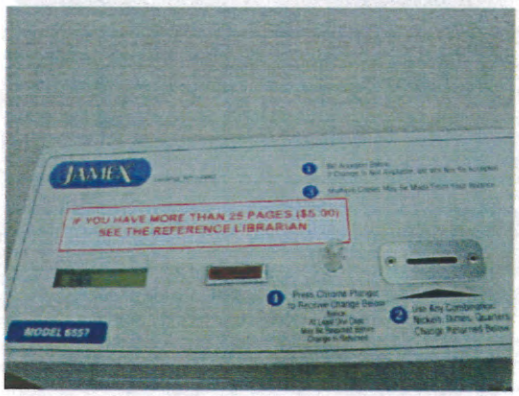

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

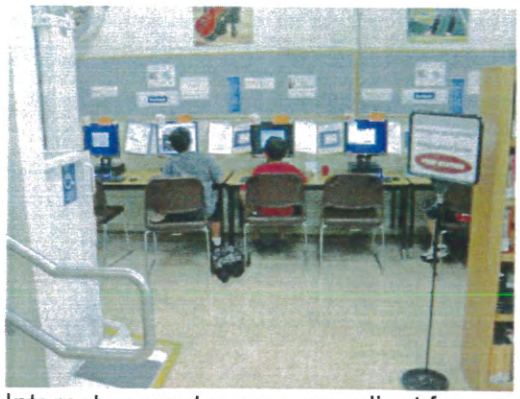

Internet computer area compliant for path of travel access and turning radius

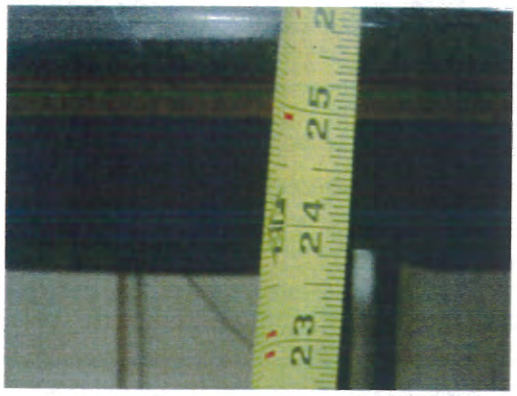

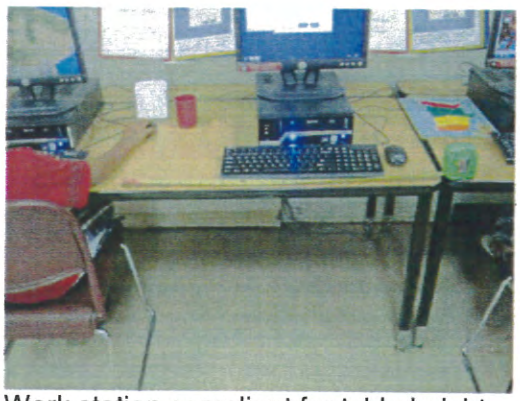

Work station compliant for table height, leg clearance and clear width of station. Not all stations have access clearance. Recommend identifying this station with ISA sign

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Disabled access lift for upper level.
Compliant for access path, size, operation and controls

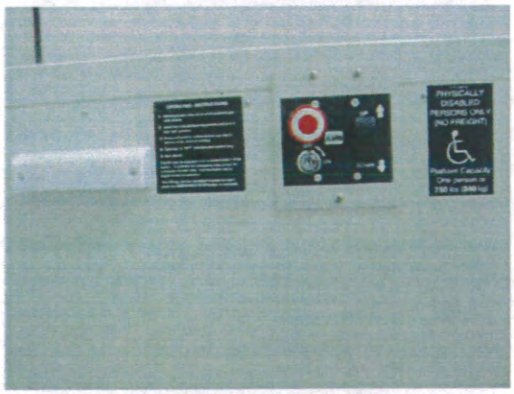

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

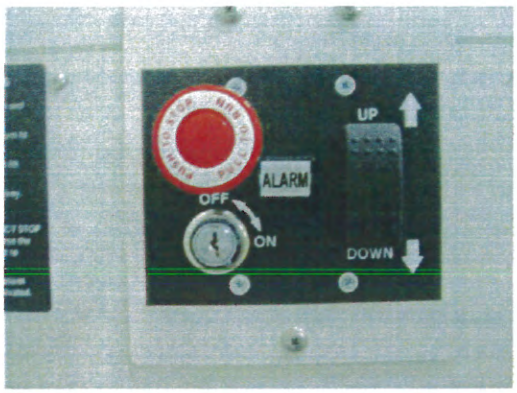

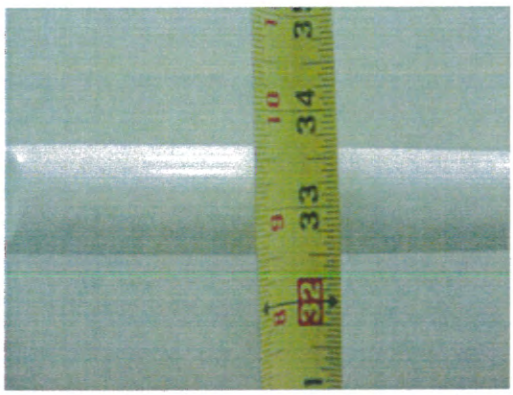

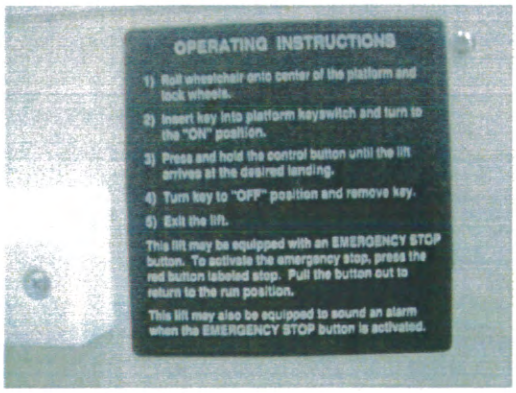

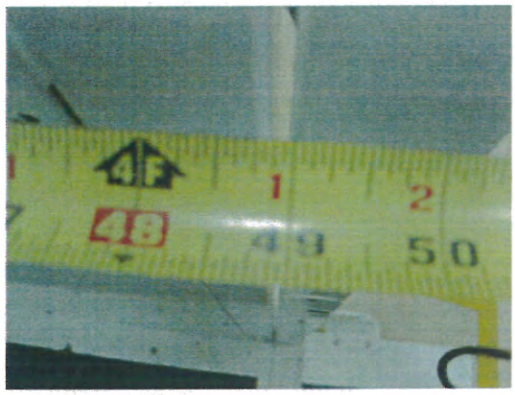

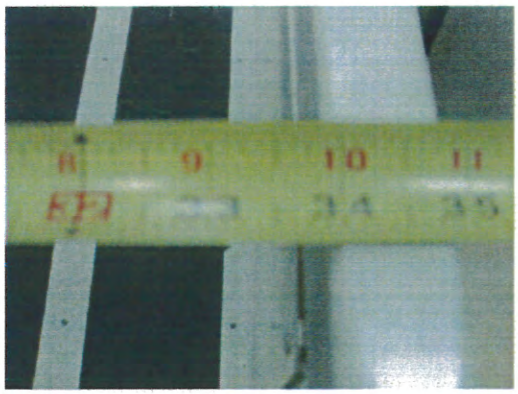

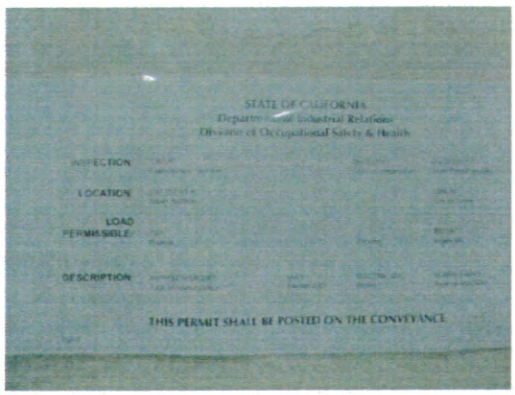

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Upper level lift gate

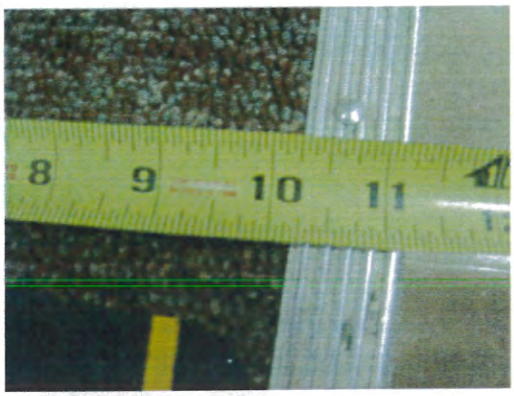

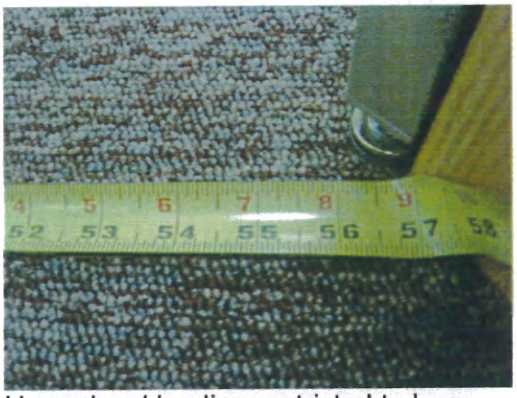

Upper level landing restricted to less than 60" with movable partition

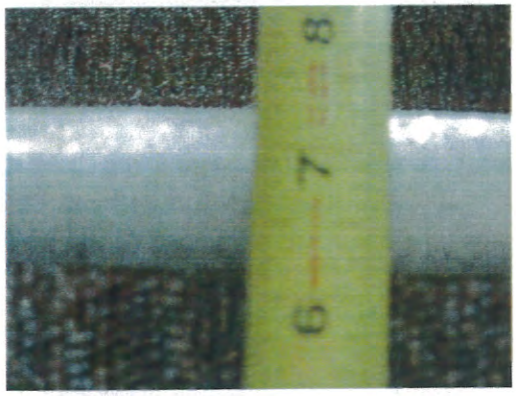

Stairs to upper level. Compliant except for required upper and lower tread marking – 2 -4" stripe of contrasting color

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

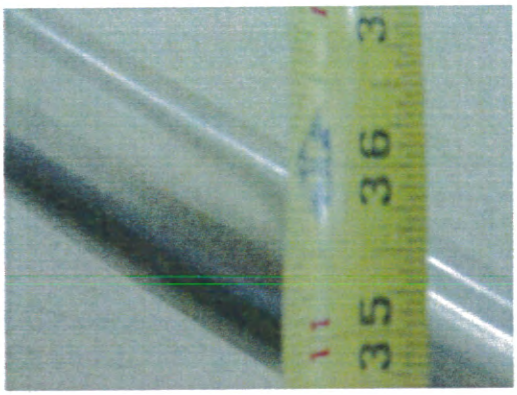

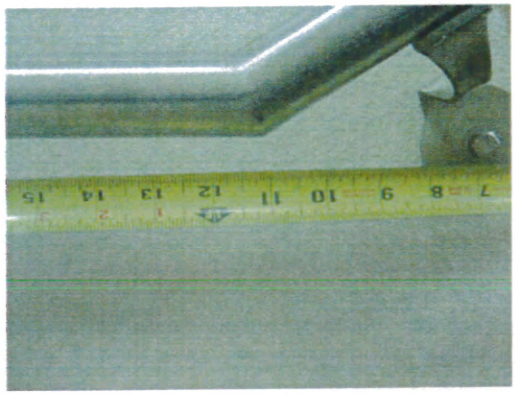

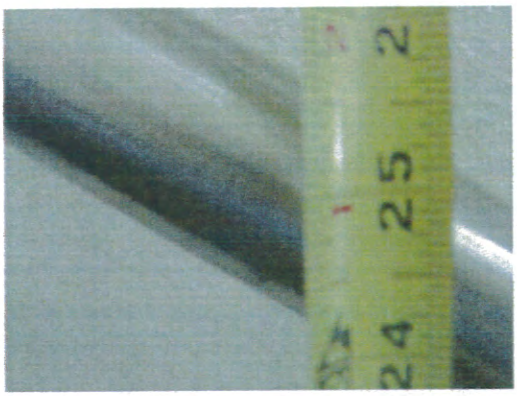

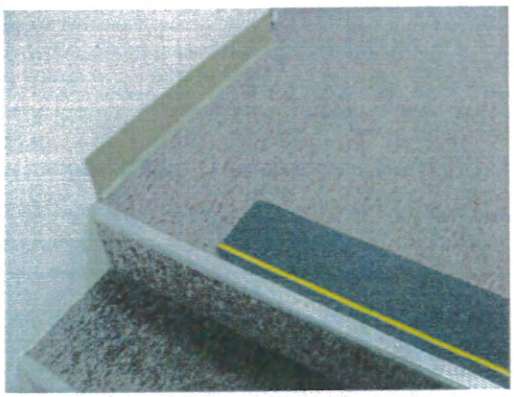

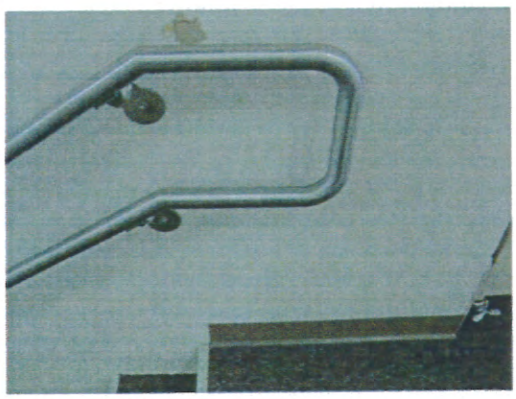

Accessibility Design Associates LLC
710 12 Street,Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

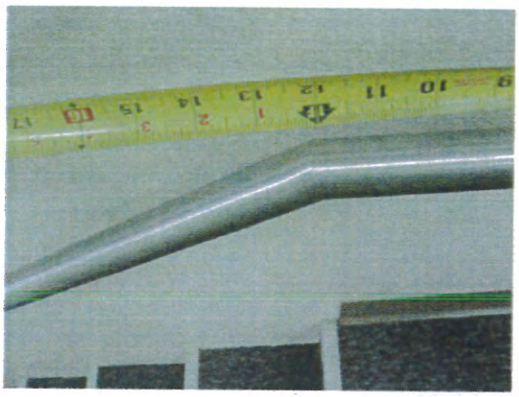

Handrail extension of a protruding object. Needs connecting down to floor

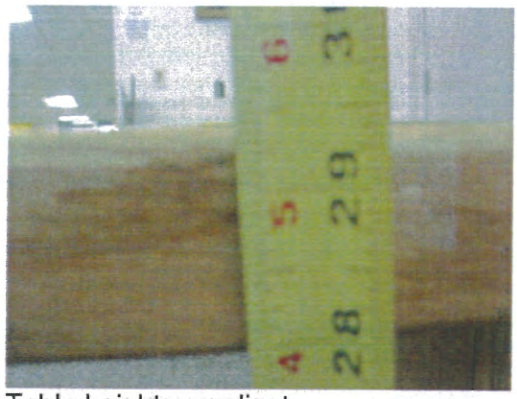

Table height compliant

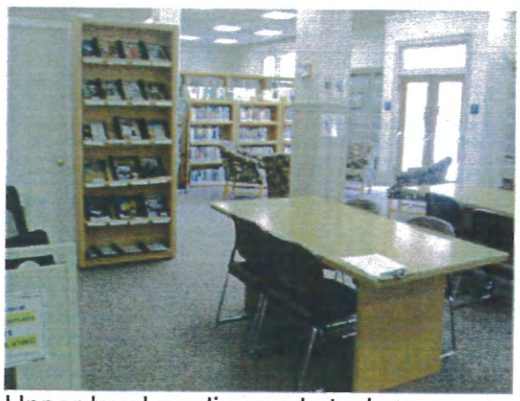

Upper level reading and stack area. Aisle widths compliant, seating compliant

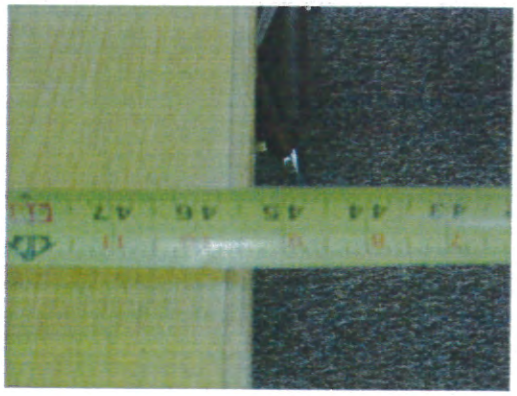

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

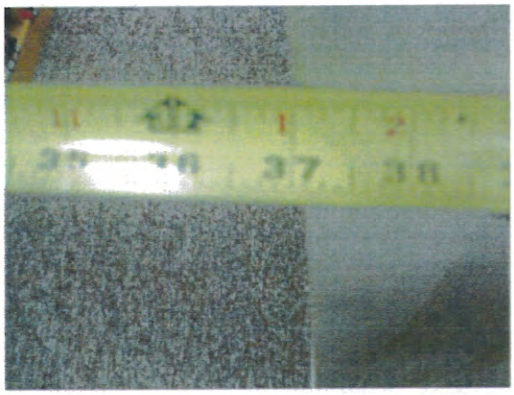

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

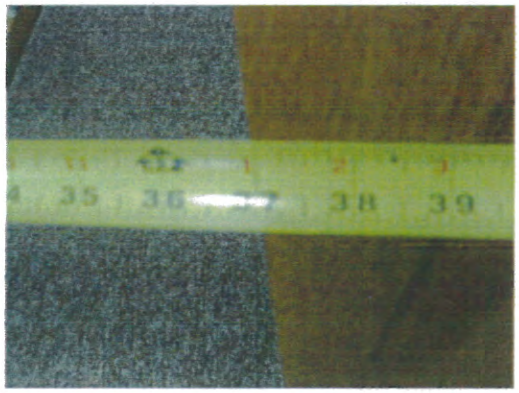

End aisle with typewriter table restricted to less than 36" at table. Relocate table to another location

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

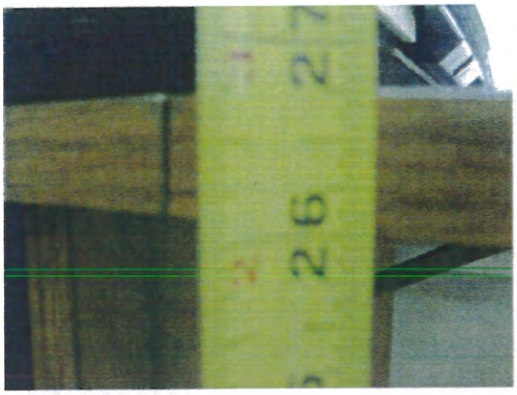

Table width clearance not compliant at less than 30". Replace with compliant table

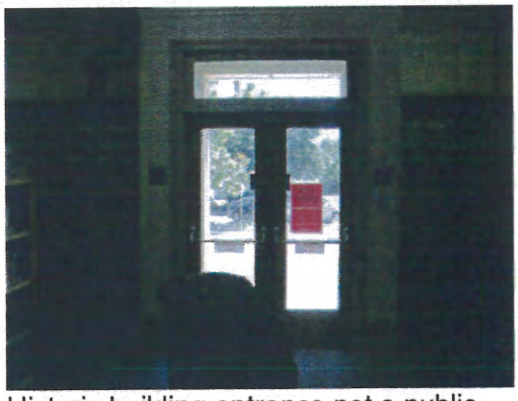

Historic building entrance not a public path of travel for entry or exiting

Public toilet rooms at entry to library no accessible compliant due to door widths and interior clearance. Alternate Unisex restroom provided

Accessibility Design Associates LLC
710 12 Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Non- Compliant Women's Interior

Non- Compliant Men's Interior

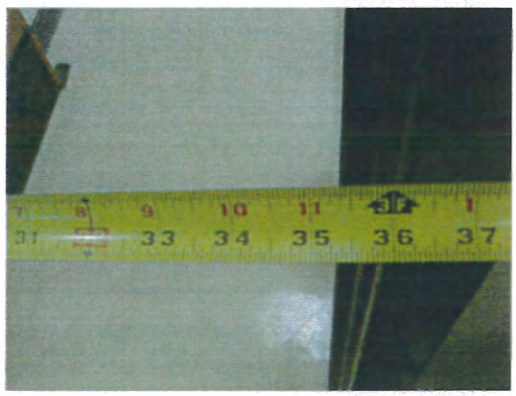

Path of access and signage to disabled compliant toilet room compliant. Door is always open but size and hardware is compliant

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Door to unisex toilet room compliant for signage, size, hardware and pull weight

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Interior button lock compliant

Kick compliant

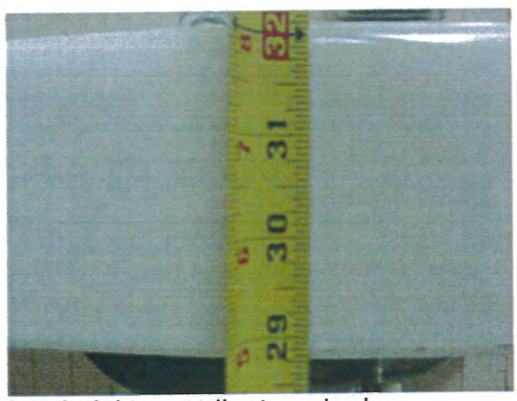

Lav height compliant, under lav clearance short by ¼"

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Mirror too high. Reflective surface to be no more than 40" above floor

Hot water supply not insulated

Soap dispenser height compliant

Faucet non compliant. Needs lever handle

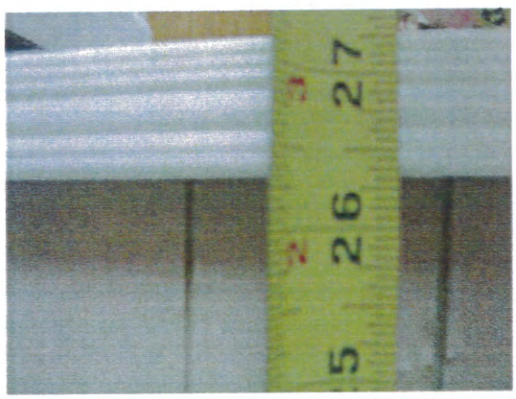

Accessibility Design Associates LLC
710 12 Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

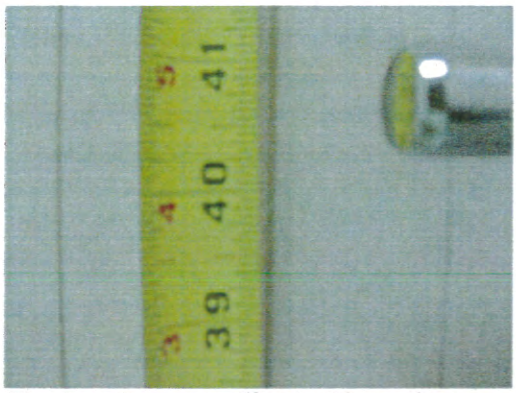

Flush valve compliant at less than 44" aff.

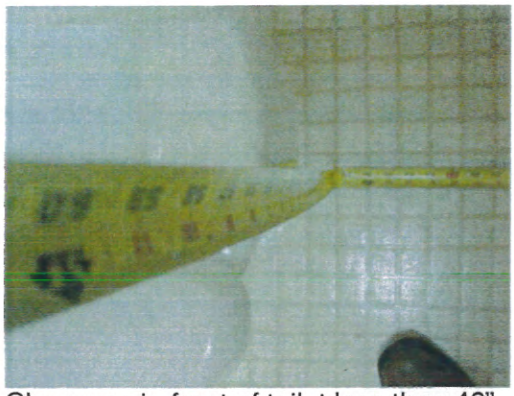

Clearance in front of toilet less than 48". Restricted at one corner of the 30" x 48" access by 10"

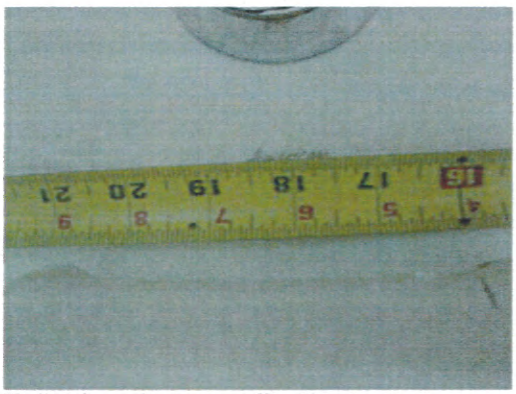

Toilet location compliant

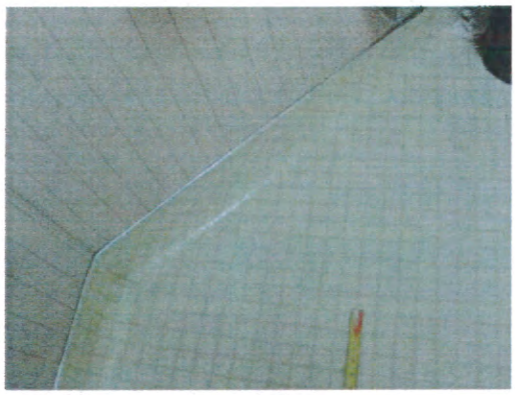

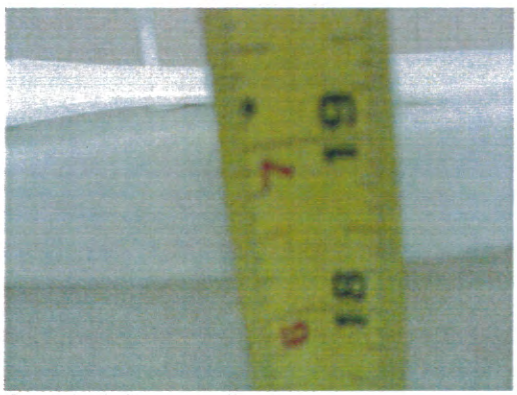

Seat height compliant

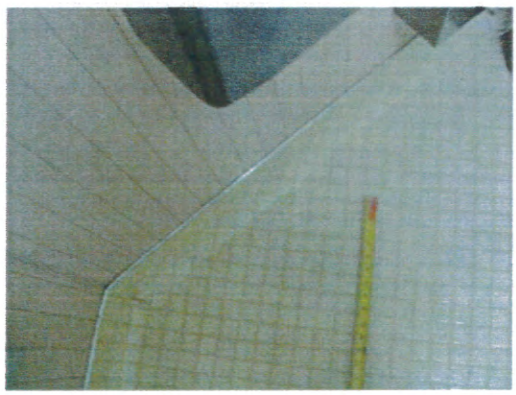

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

Side bar length compliant

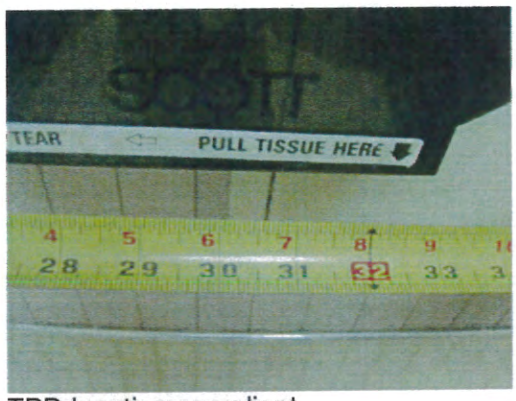

TPD location compliant

End of bar to be at 54"

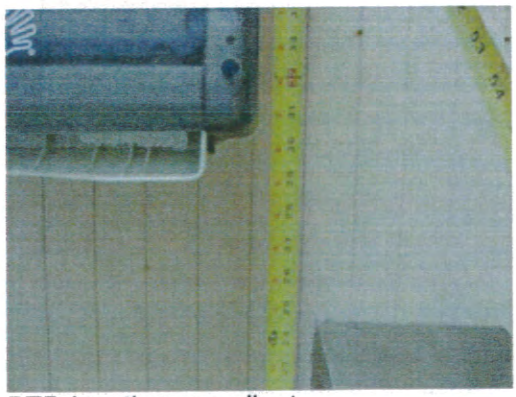
PTD location compliant

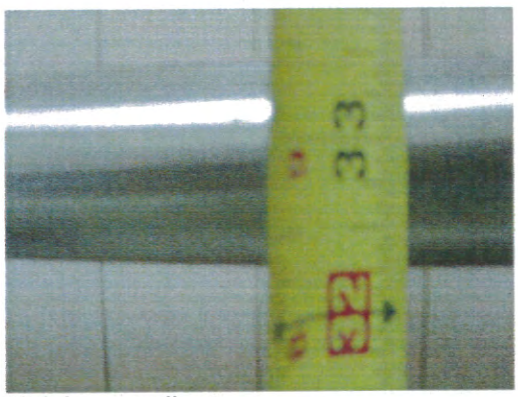
Height compliant

Interior clearances compliant

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

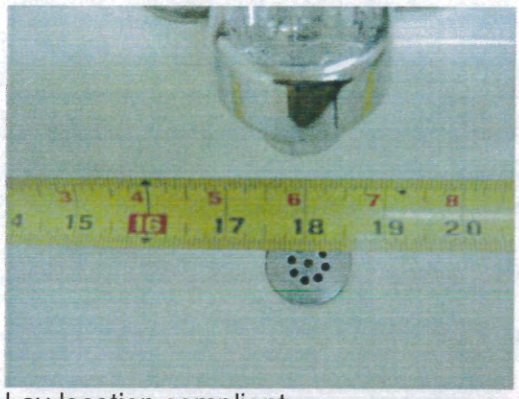

Lav location compliant

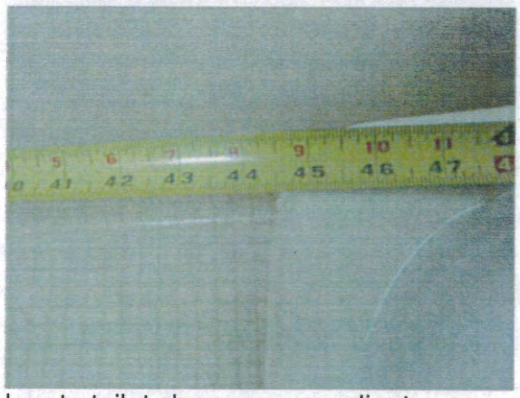

Lav to toilet clearance compliant

Accessibility Design Associates LLC
710 12th Street Sacramento, Ca 95814 916 806 6263 916 448 1901
email: bruce@adallc.biz

These premises have been inspected by a Certified Access Specialist (CASp).

ACCESS

Inspection Date: 5/23/2012 CASp Signature:

CASp Certificate #: 156 CASp Name: Bruce Monighan
(please print)

http://www.dsa.dgs.ca.gov/Access/casp.htm

Inspection Certificate #: 05952

The Public Accommodation areas of this complex have received a CASP Inspection on May 23, 2012 and has received the "CASp Determination Pending" status. The management is maintaining a list of barriers who's removal is considered readily achievable as defined in ADA 36.104 and has a schedule for the removal of those barriers

The Public Accommodation areas of this complex have received a CASP Inspection on May 23, 2012 and has received the "CASp Determination Pending" status. The management is maintaining a list of barriers who's removal is considered readily achievable as defined in ADA 36.104 and has a schedule for the removal of those barriers

Priorities for Barrier Removal

When funds are not available to remove all existing barriers, the **Department of Justice** (DOJ) recommends an order of priorities for barrier removal:

1. Provide access from public transportation, parking areas, sidewalks, and entrances to the public accommodation so a person with a disability can "get through the door," (e.g., installing an entrance ramp, widening entrances, and providing accessible parking spaces).
2. Provide access to those areas where goods and services are provided (e.g., adjusting the layout of display racks, clearing routes to exam rooms, rearranging tables, providing braille and raised character signage, widening doors, providing visual alarms, and installing ramps).
3. Provide access to rest room facilities when they are open to the public (e.g., removal of obstructing furniture or vending machines, widening of doors, installing of ramps, providing accessible signage, widening of toilet stalls, and installation of grab bars).
4. Take other measures to provide access to goods, services, or facilities